



## Hanging weight scale with distance viewing

- Weight can be viewed from a distance of up to 100 metres with the wireless control.
- Multifunction LCD display.
  - Made from treated steel.
  - Rechargeable internal battery.
  - Indicator with integrated printer (Optional).



### Functions:

- Setting to zero.
- Tare function.
- Accumulation and totalization of weighings.
- Hold function.
- Auto power-off.

### Remote printing of weighings

With the optional C6P remote control you can print the weighing results in the command itself as well as control all functions of the weighing hook from your hand.



### Remote indication and control

The integrated remote control commands all the functions of the remote unit as well as viewing the weight, accumulation and totalization thanks to its multifunction viewer.


Model	C7-3T	C7-5T	C7-10T
Reference	71170	71171	71172
Capacity	3.000 kg	5.000 kg	10.000 kg
Resolution	1 kg	2 kg	5 kg
Weighing units	kg, pound		
Tare range	100%		
Material of the structure	Cast steel		
Display	Multifunction LCD		
Power	Rechargeable battery		
Battery duration	30 hours		
Working temperature	+0°C / +40°C		
Hook opening (mm)	30	35	45
External dimensions (mm)	110 x 500 x 140	110 x 590 x 160	110 x 640 x 185
Total net weight (kg)	7,7	10,6	16,1
Packaging dimensions (mm)	580 x 275 x 330	580 x 275 x 330	580 x 275 x 330
Total weight with packaging (kg)	9,5	12,3	17,8

Ref.	Options
8030	ISOCAL certificate from 1501 kg to 3000 kg
8033	ISOCAL certificate from 3001 kg to 10000 kg

Ref.	Accessories
60953	Remote indicator with C6P Printer

### Dimensions (mm)

C7

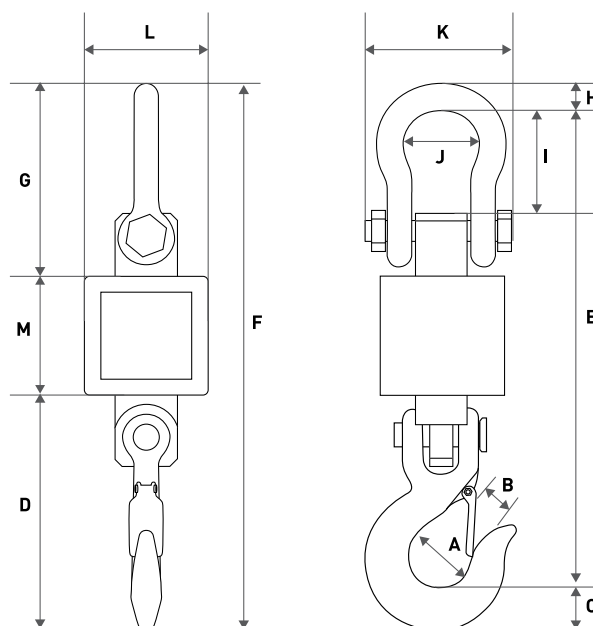

Model	A	B	C	D	E	F	G	H	I	J	K	L	M
C7-3T (mm)	56	35	50	200	426	500	180	24	95	55	140	110	107
C7-5T (mm)	60	36	50	260	514	590	210	26	120	75	160	110	107
C7-10T (mm)	75	44	67	300	543	640	220	30	110	90	185	110	107